

Work Order ID 50703

July 21, 2009 10:01:52 AM

Page 1

Item ID: D212-664-107TRN

Accept

Setup Start

Revision ID: A

Stop

Item Name: Crosstube Turning Detail

Start Date: 07/21/2009 Start Qty: 1.00

Cust Item ID:

Required Date: 07/31/2009 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: mf

Date: 09-07-21

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D212-664-147

Rev A

100

0.00



Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA705
2-Turn first side as per Folio FA113
3-File down transition lines smooth.

Q.m 09 - 08 - 13 @

110

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Q.m 09 - 08 - 13 @

120

0.00



Mori Seiki

MORI SEIKI CNC LATHE LARGE

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA705
2-File down transition lines smooth.
3- Remove plugs and sand

Q.m 09 - 08 - 13 @

Work Order ID 50703

July 21, 2009 10:01:52 AM



Page 2

Item ID: D212-664-107TRN

Accept



Setup Start



Revision ID: A

Stop



Item Name: Crosstube Turning Detail

Start Date: 07/21/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 07/31/2009 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

Am 09 - 08 - 13 @

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00

Quality Control

1 Ø - Am 9-8-14

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1 Ø - Am 9-8-13

Work Order ID 50703

July 21, 2009 10:01:52 AM



Page 3

Item ID: D212-664-107TRN

Accept



Setup Start



Revision ID: A

Stop



Item Name: Crosstube Turning Detail

Start Date: 07/21/2009 Start Qty: 1.00



Cust Item ID:

Required Date: 07/31/2009 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

160

QC3- Inspect Part Finish

0.00



QC

Memo

9-8-14

0.00

Quality Control

170

Packaging

0.00



Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack ☐ Location: X-TUBE CELL

1 8 - Awn 7-8-14

180

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

09/08/19
mf 09-08-14

Picklist Print

July 21, 2009 10:01:52 AM

Page 1

Work Order ID: 50703



Parent Item: D212-664-107TRNRevA



Parent Item Name: Crosstube Turning Detail

Start Date: 07/21/2009

Required Date: 07/31/2009

Comments:

Start Qty: 1.00

Required Qty: 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D6019-128RevA		Manufactured	No			110	Each	22.0000	1.0000			



Crosstube Material



Am 09.08.13

<u>Warehouse</u>	<u>Loc Qty</u>	<u>Loc Code</u>
<u>Location</u>		
Main Warehouse		
LG	22	
29369	7	
32310	15	

/

DART AEROSPACE LTD	Work Order: 50703
Description: Crosstube Assembly (205/212/412 Low Fwd)	Part Number: D212-664-147
Inspection Dwg: D212-664-147 Rev: A	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.313	+/-0.010	0.313	✓		
	2.360	+0.005/-0.000	2.362	✓		
	2.360	+0.005/-0.000	2.362	✓		
	2.366	+0.005/-0.000	2.367	✓		
	2.473	+0.005/-0.000	2.477	✓		
	2.573	+0.005/-0.000	2.576	✓		
	2.673	+0.005/-0.000	2.675	✓		
	2.750	+0.005/-0.000	2.750	✓		
	2.750	+0.005/-0.000	2.750	✓		
SIDE B	0.313	+/-0.010	0.313	✓		
	2.360	+0.005/-0.000	2.362	✓		
	2.360	+0.005/-0.000	2.362	✓		
	2.366	+0.005/-0.000	2.367	✓		
	2.473	+0.005/-0.000	2.477	✓		
	2.573	+0.005/-0.000	2.576	✓		
	2.673	+0.005/-0.000	2.675	✓		
	2.750	+0.005/-0.000	2.750	✓		
	2.750	+0.005/-0.000	2.750	✓		
	0.126.53	+/-0.020	126.550			

Measured by: A.M.	Audited by: ALM	Prototype Approval:	N/A
Date: 09.08.13	Date: 9.8.14	Date:	N/A
Rev	Date	Change	Revised by
A	08.11.07	New Issue (P/O D212-664-107)	KJ/EC
			Approved

PARTS LIST:

Qty	Part Number	Description
X	D212-664-147	CROSSTUBE ASSEMBLY (205/212/412 LOW FWD)
1	D6019-128	CROSSTUBE
2	D2893-1	SUPPORT
4	D3595-063-450	RUBBER CUSHION
2	D3659-1	CUFF
4	MS21920-25	CLAMP (OR MS21920-26)
44	CR3212-4-06	RIVET (OR M7885/3-4-06)
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:




- 1) MATERIAL: MANUFACTURED FROM D6019-128
FINISHED LENGTH = 126.53±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 3) TOLERANCES ARE PER DART QSI 016 UNLESS OTHERWISE NOTED.
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) PART IS SYMMETRIC ABOUT CENTERLINE.
- 6) WHEN MACHINING TAPER, RUN-OFF PART AT STOCK. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 7) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D., EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 8) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 9) SCRIBE DART PART NUMBER AND BATCH NUMBER ON INNER SURFACE OF TUBE WITH A
VIBRATING STYLUS.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1
THAT WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE
D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE
CROSSTUBE SUPPORT.
- 13) TORQUE CLAMPS 80 TO 100 IN.-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY
AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 14) INSTALL D3659-1 CUFF AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A
LAYER OF SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN
CUFF AND CROSSTUBE. SEAL EDGE OF CUFF TO ENSURE NO GAPS.
- 15) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.

#50703
MF
09-07-21


DEO ATTACHED

RELEASED
07.09.24

A		07.07.07	NEW ISSUE
DESIGN	qp	DRAWN BY	qp
CHECKED		APPROVED	DART
DATE		DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA	
07.07.07		DRAWING NO. D212-664-147	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		REV. A SHEET 1 OF 3 SCALE CROSSTUBE (205/212/412 LOW FWD) NTS	

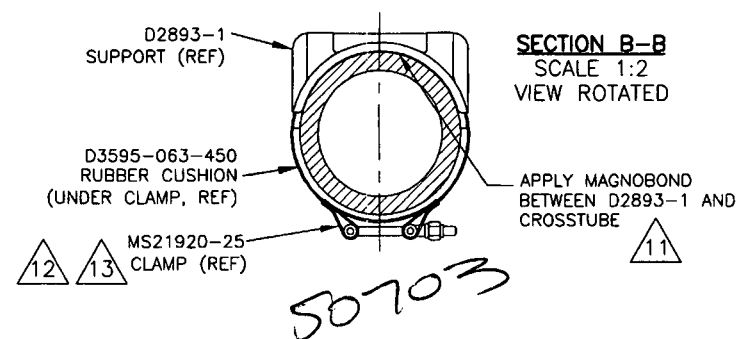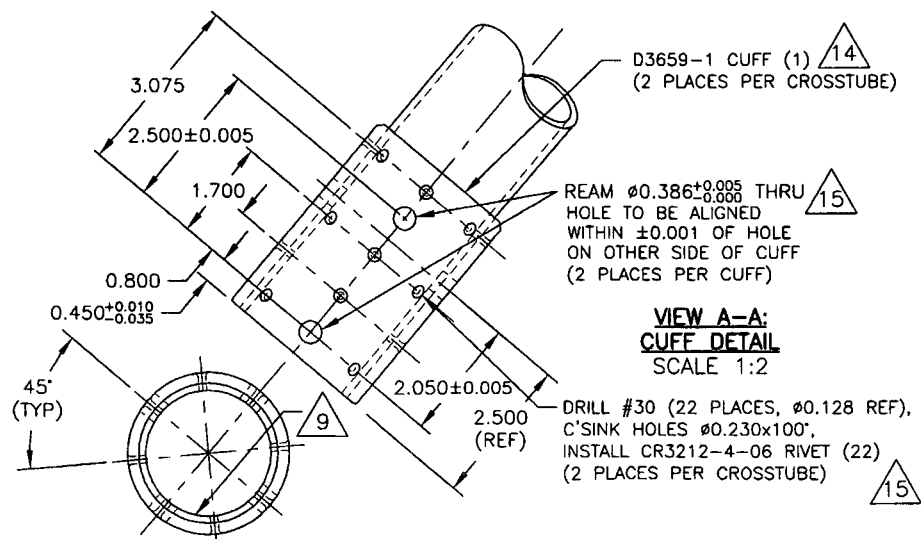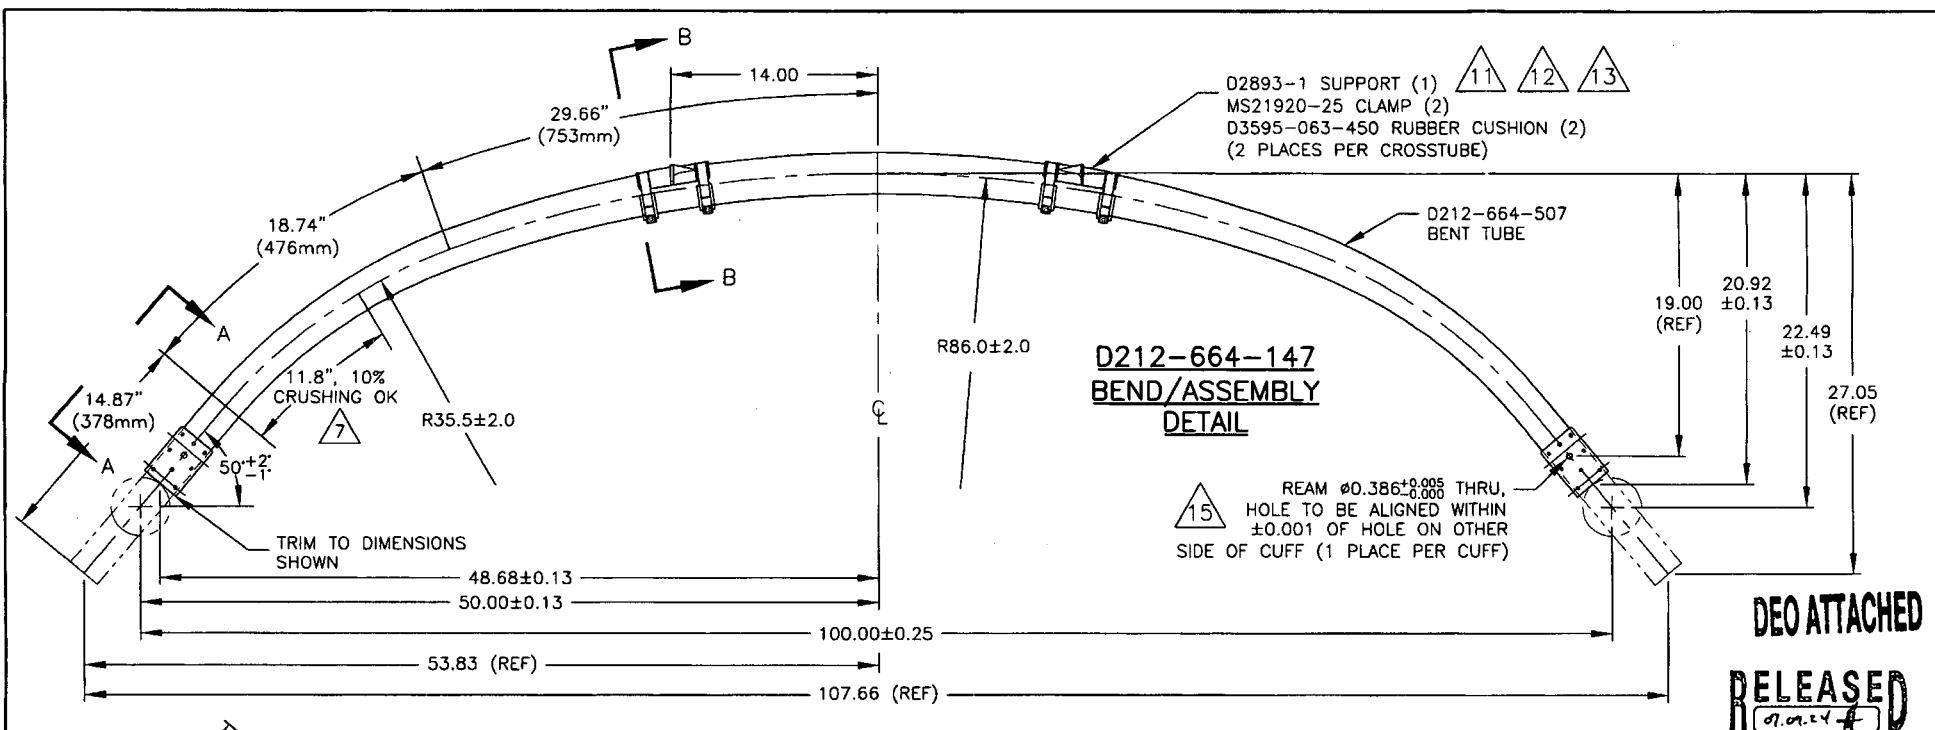

COPYRIGHT © 2007 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED RAH	APPROVED H	DRAWING NO. D212-664-147	REV. A SHEET 2 OF 3
DATE 07.07.07		TITLE CROSSTUBE (205/212/412 LOW FWD)		SCALE 1:8	

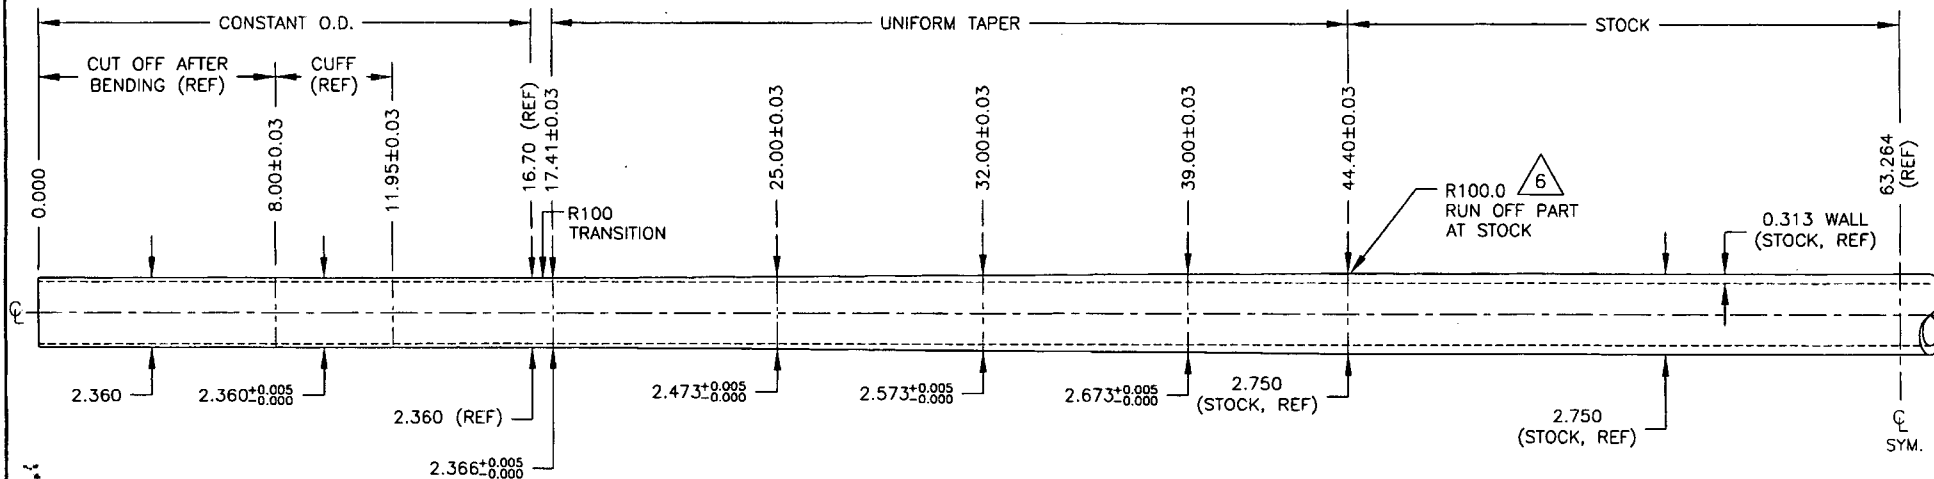

D212-664-147 MACHINING DETAIL

RELEASED
07.09.24

DEO ATTACHED

50703

COPYRIGHT © 2007 BY DART AEROSPACE LTD.		DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART	DART AEROSPACE LTD. MARKESBURG, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED <i>qp</i>	APPROVED <i>qp</i>	DRAWING NO. D212-664-147	REV. A SHEET 3 OF 3
DATE 07.07.07		TITLE CROSSTUBE (205/212/412 LOW FWD)		SCALE 1:4	

DRAWING NO. D212-664-147	TITLE CROSSTUBE	REV. A	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-147-A-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>JD</i>	CHECKED <i>pt</i>	MFG. APPR. <i>E</i>	APPROVED <i>Ad</i>		DE APPR. <i>th</i>		
DATE 09.05.01	DATE 09.06.15	DATE 09.06.15	DATE 09/06/16		DATE 09/06/16		


CHANGE:

ADD THE FOLLOWING CROSSTUBE ASSEMBLY:

Part Number	Description
D212-664-147B	CROSSTUBE ASSEMBLY (214 LOW FWD)

THE D212-664-147B CROSSTUBE HAS THE SAME PARTS LIST AS THE D212-664-147 CROSSTUBE. HOWEVER, INSTALL THE SUPPORTS AS SHOWN IN FIGURE 1 OF THIS ENGINEERING ORDER. THE NEW KIT IS OTHERWISE ASSEMBLED PER THE D212-664-147 CROSSTUBE.

RELEASED
09/06/22 *th*

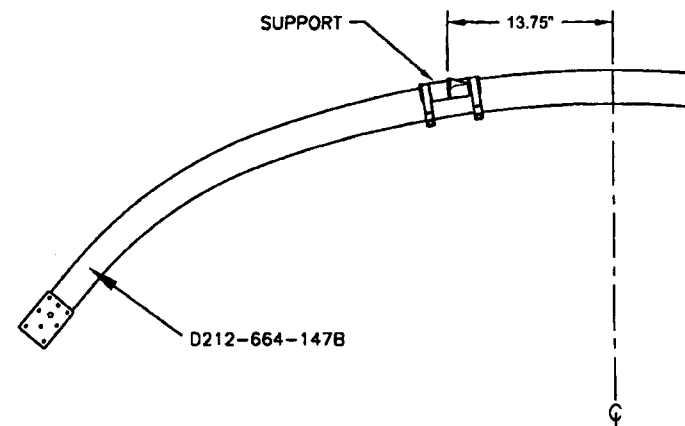

50703

FIGURE 1 - SUPPORT INSTALLATION